


POLARIS

RACING

MY21 600R Handlebar heater switch wired incorrect

P1 and P3 connectors at the plastic plug for the handlebar High-Low heater switch need to be switched. Switch the Orange/Green & Blue wire plug position with the Blue/Red & Grey/White plug position in the plastic plug for the High-Low heater switch. Refer to below pictures for reference.

Stock incorrect wiring orientation

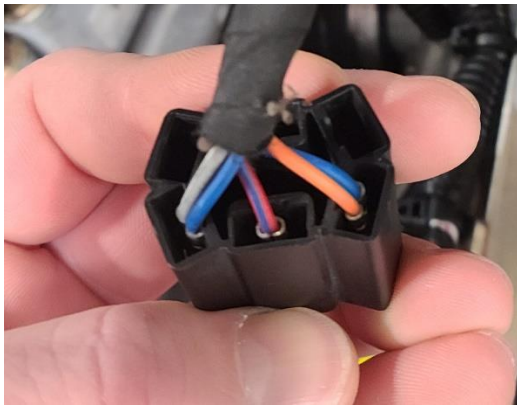

Correct wiring orientation

